


THE **adlog**<sup>TM</sup> AIRCRAFT  
MAINTENANCE  
RECORDKEEPING  
SYSTEM

**AIRFRAME  
MAINTENANCE  
RECORDS**





DATE	TOTAL TIME IN SERVICE	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
			<b>TOTAL</b> brought forward from previous page
			<p><b>Date:</b> 08/08/2018    <b>Hours:</b></p> <p><b>Tail#:</b> N201DC</p> <p><b>Make:</b> MOONEY                      <b>Model:</b> M20J                      <b>S/N:</b> 24-3103</p> <p>C/W 100 HR/ ANNUAL INSPECTION ON THIS AIRFRAME IAW FAR 43 APP (d) USING MOONEY M20J INSPECTION CHECKLIST AS A GUIDE. C/W FAR 91.207D ELT CHECK GOOD. NEXT BATTERY REPLACEMENT DUE 9/2019. NEXT FAR 91.411 AND 91.413 ARE DUE 5/31/2020. REPLACED ENGINE AIR FILTER WITH NEW BA6205. REPLACED VACUUM OUTLET FILTER WITH NEW. C/W 12 MONTH INSP/ WEIGHT CHECK OF CABIN FIRE EXTINGUISHER. C/W AD 76-07-12 OPS CHECK OF BENDIX IGN SWITCH. REPLACED BOTH LOWER NLG DOOR ROD ENDS WITH NEW. REPLACE ALL LANDING GEAR SHOCK DISCS WITH NEW. INSTALLED NOSE STEERING COLLAR SHIM. REPLACED NLG STEERING ROD END. C/W AD 97-26-08 REPLACEMENT OF FUEL CAP O- RINGS. ADS CHECKED THROUGH CURRENT 2018-15.</p> <p>I CERTIFY THIS AIRFRAME HAS BEEN INSPECTED IAW AN ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.</p> <p><b>Name:</b> Chris Barcenas                      <b>Cert:</b> </p> <p><b>Co:</b> Charlie Bravo Services                      <b>Sign:</b> _____</p>
			<p><i>AIRFRAME LOG ENTRY</i></p> <p><i>3/19/2019 MOONEY M20J S/N 24-3103</i></p> <p><i>TACH TIME 211.2</i></p> <ol style="list-style-type: none"> <li><i>1) REMOVED AND REPLACED AIRCRAFT COMPASS</i></li> <li><i>2) REMOVED AND REPLACE COPILOT'S PHONE JACK</i></li> <li><i>3) SWING COMPASS AND CORRECTED COMPASS</i></li> </ol> <p><i>RETURNED AIRCRAFT TO SERVICE FOR ABOVE WORK</i></p> <p><i>JAMES FLEMING 3437266 AMP</i></p> <p><i>BEST AVIATION INC</i></p>
			<p><b>S</b></p> <p><b>TOTAL</b>-Carry forward to next page</p>



MAKE: Mooney  
MODEL: M20J  
S/N: 24-3103  
REG. NO: N201DC  
WORK ORDER  
3393-02-2021

**Don Maxwell Aviation Services, Inc.**

390 Central Road  
Longview, Tx 75603  
Phone: 903-643-9902

DATE: 9/3/2021  
A/C TSN: 2879.6  
TACH: 0

**Airframe Entries**

(1) Removed all factory gauges and instruments and installed Garmin G3X 10' display with GSU and EIS. Installed Garmin G5 as G3X-backup with battery.... (2) Removed KX155 nav/com and installed Garmin GTR 20.... (3) Removed King KCS 55 system with KAP 150 autopilot and installed Garmin G3X system with Garmin GFC 500 autopilot with pitch, trim, pitch-trim and yaw servos.

Paul Maxwell A&P 2791171

DATE: 9/3/2021

SIGNED:



Work Order: 3393-02-2021

Printed by EBis 3 (datcomedia.com)

**Precision Aircraft Services**  
**PO Box 60273**  
**San Angelo, Texas 76906**  
**325 949 0643**

6.9

D,

Date 12-03-2020 Tach: 265.7 TT: 2863.50 N201DC

Removed and replaced cabin door extender (PN 310118-503). Ops checked good. Glued loose door seal to forward side of baggage door.

Scott Hinds  AP - 3577078

**Precision Aircraft Services**  
**PO box 60273**  
**San Angelo, Texas 76906**

2871.5

02-02-2021 Tach; 272.1 Total; 2916.3 N201DC

Inspected airframe IAW FAR 91.409[a][1] and Mooney M20J maintenance manual. C/W FAR 91.207[d] inspect ELT and functional check, op's ck'd ok, due Nov. 2021. Bled both brakes. Clean and pack all wheel bearings. Sealed fuel leaks at inboard fuel tank panels at screws. C/W AD 76-07-12 R1 functional check mag switch, op's checked ok. C/W AD2015-19-07 fuel injector lines and clamps inspected, due 110 hrs, or when worked on. C/W AD99-24-10 Precise Flight Stand By SVS III vacuum system inspection and operational checked good. Replaced Rapco RA2J4-6 instrument filter. Replaced LH and RH Tires 070-314-0 600X6 6ply Michelin Air tires. Resealed LH brake wheel cylinder. Bled both brakes. Replaced emergency gear extension cable with new 102048-1 cable and drum assy. Clean fuel gasculator. Service and checked battery.

I certify that this aircraft has been inspected in accordance with an annual inspection and was determined to be in airworthy condition.

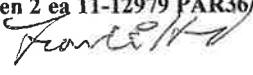
Frank E. Hinds   
AP2042285 IA

**Precision Aircraft Services**  
**PO box 60273**  
**San Angelo, Texas 76906**

2879.6

09-30-2021-2021 Engine time; 30.0 N201DC TT 2909.6

Replaced external lights with Whelen 500 Orion tail Beacon, LH 6502 Red nav, and beacon, RH Green nav 6502 nav and beacon. Replaced Wing tip White tail nav bulbs with new 34-0228030-85 bulbs. Replaced landing and taxi lights with Whelen 2 ea 11-12979 PAR36/28V, and P46P2L.

Frank E. Hinds   
AP2042285

wo: 36931

Airframe - page 1 of 1



Angelo Precision Aircraft, LLC - 9134 Hanger Rd - SAN ANGELO, TX 76904 - 325-949-0643

N201DC  
TACH: 100.1

MOONEY, M20J, S/N: 24-3103

June 29, 2022

- Dead Battery** - Removed access panel on left side of the fuselage. Removed and replaced battery with new RG24-15 SN 41229540 Installed P/N RG24-15 - CONCORDE RG-24-15 PLATINUM SERIES SEALED LEAD ACID AIRCRAFT BATTERY S/N: 41229540. Removed and replaced battery hold down bar with new PN 9771. Operational checked battery and checked good.

With respect to the work performed, this airframe is approved for return to service. Details of work performed are on file with Angelo Precision Aircraft, LLC under work order: 36931

Scott Hinds Airframe and Powerplant AP - 3577078 

SUB-TOTAL this page

TOTAL-Carry forward to next page

